



PORTABLE BATTERY POWERED LOAD INDICATOR (3-1/2 Digit, Handheld)

Indication is direct. No multipliers are required, thus avoiding ambiguous readings. Resolution is from 1 pound to 1000 pounds depending on the load capacity of the transducer. Alternate display units are available.

Operation is extremely simple. For normal use only two controls are involved. Turn on the power switch, set no load balance, and begin reading applied loads.

A calibration check function is included to provide a quick test of the transducer and instrument integrity.

The readout system is fully contained in a cast metal case that is both rugged and durable.

Power is provided by a set of rechargeable batteries. Batteries and a recharger with retractable 120 Vac power cord, are included within the housing.

Battery power allows complete freedom of use and provides 5-10 hours of continuous use depending on transducer resistance. A ratiometric measuring technique prevents battery decay from degrading system accuracy.

When battery voltage has decreased below a functional level, a visual display (flashing “:”) signals that recharging is needed.

Recharging is done by withdrawing the line cord from its sealed compartment and plugging into a standard 110 Vac wall receptacle. Batteries are completely recharged overnight and can be left “on charge” indefinitely.

PLN-D2 **Portable Load Indicator (3-1/2 DIGIT)**



SPECIFICATIONS

RANGE:

Displayed directly in pounds up to 199900
Displayed in kips above 199900 pounds.

RESOLUTION:

Transducer Capacity	Dummy Zero's	Pounds Per Count
0 – 1999	NONE	1
0 – 19990	1	10
0 – 199900	2	100
0 – 199.9 KIPS	NONE	100
0 – 1999 KIPS	NONE	1000
0 – 19990 KIPS	1	10000

Display:

3-1/2 digit, one or two dummy 0's optional.

Display Accuracy:

±1 count

Display Size:

1/2" inch Liquid Crystal Display

Zero Balance Range:

±20% full scale (FS)

Calibration Check:

Preset to approximately 80% F.S.

Case Size:

5" x 7-1/2" x 2"

Weight:

2-1/2 lbs.

Nickel Cadmium Batteries and Recharger included.

Transducer cable connector: PT06A-10-6P(SR)


Visual Display of Low Battery, Over Range, Polarity.

PORTABLE BATTERY POWERED LOAD INDICATOR (3-1/2 Digit, Handheld)

ORDERING INFORMATION

Note: When ordering specify full scale load capacity, units of measure, input sensitivity, and bridge resistance.

PLN-D2 (25,000 POUND, 2-mv/V, 350 Ohms)

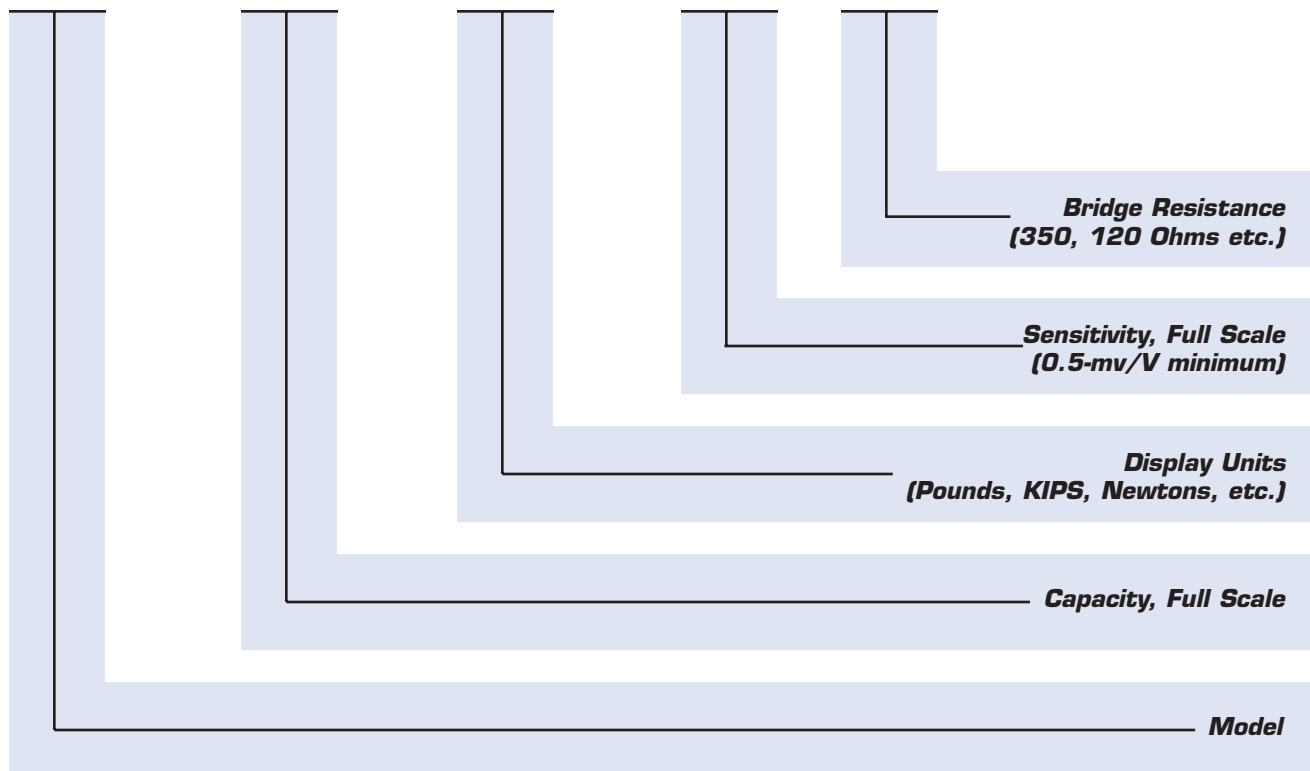

Mating Connector – P/N Bx6P

Replacement Battery Set – P/N HW1D-290-6 (Set of 8 Nickel Cadmium "AA" 1.2V)

Optional Protective Carrying Case – Model PLN



**Strainert Model PLN-D2
with CPA Series Clevis Pin**

INTERTECHNOLOGY
1-800-465-1600
INC.

19 Waterman Ave. Toronto, Ont. M4B1Y2
Tel: 416-445-5500 Fax: 416-445-1170

Toll Free: 1-800-465-1600

Email: sales@intertechnology.com

Website: www.intertechnology.com